



THE ENSTROM HELICOPTER CORPORATION
TWIN COUNTY AIRPORT, P.O. BOX 490, MENOMINEE, MICHIGAN 49858

SERVICE INFORMATION LETTER

SERVICE LETTER NO. 0012

DATE: September 19, 1969

SUBJECT: Roll Pin - Friction Lock Handle - Collective Control

MODELS: F-28A

SERIAL NO: All

On some aircraft, a .062 diameter roll pin was installed instead of a .062 diameter dowel pin.

Several instances have occurred in which the roll pin has sheared on the friction lock handle.

To prevent this occurrence, it is recommended that all aircraft covered by this letter be inspected for security of the friction lock handle. Furthermore, where .062 diameter roll pins are found to be installed on any aircraft, it is urged that they be replaced with the double-walled .093 diameter roll pins enclosed with this letter at the first opportunity.