



**THE ENSTROM HELICOPTER CORPORATION**  
**TWIN COUNTY AIRPORT, P.O. BOX 490, MENOMINEE, MICHIGAN 49858**

# SERVICE INFORMATION LETTER

---

---

SERVICE INFORMATION LETTER NO. 0082

Date: December 13, 1978  
Subject: Replacement Oil Lines  
Models: F-28C and 280C  
Effectivity: All aircraft up to Serial Numbers 425 and 1145  
Compliance: At Owners Discretion and Convenience

There have been three reported incidences of oil coolers cracking at the oil line attachment boss. These isolated cases may have been due to abnormal stress during maintenance in the rigid oil lines going to the oil cooler.

To eliminate reoccurrence of this problem, or reduce the possibility of a failure, the rigid steel oil lines may be replaced with flexible oil line assemblies.

Parts required:

- 1 each 28-121013-1 Hose assembly
- 1 each 28-121014-1 Hose assembly
- 2 each 848FSO10-08 Adapter
- 3 each MS21919-F12 Clamp
- 1 each MS21919-F14 Clamp
- 6 each MS21919-F16 Clamp

These parts may be purchased from the Enstrom Customer Service Department