



THE ENSTROM HELICOPTER CORPORATION
TWIN COUNTY AIRPORT, P.O. BOX 490, MENOMINEE, MICHIGAN 49858

SERVICE INFORMATION LETTER

SERVICE INFORMATION LETTER NO. 0083

Date: December 14, 1978
Subject: Modification to Static Vent System
Models: F-28A, F-28C, 280 and 280C
Effectivity: All Serial Numbers up to 467, 465-2 and 1168
Compliance: At Owners Discretion

The instrument static vent system in its present configuration is susceptible to water intake and entrapment which may result in damage to the airspeed indicator. A revised system is available which will eliminate this problem.

The modification consists of

1. Removing the two vent lines P/N 28-18193-8 and 9 from the static port fittings.
2. Remove fitting P/N AN834-43 located at the lower right hand corner of the bulkhead.
3. Remove the clamp P/N 786A-4CU from the lower left side of the bulk head.

Install the following parts per drawing:

- 2 each 28-18113-1 line
- 1 each 28-18112-1 line
- 1 each AN824-4D Tee fitting
- 1 each AN832-4D Union
- 1 each AN924-40 Nut
- 2 each 786-CU Clamp
- 2 each MS21919-F4 C1amp

These parts may be purchased from the Enstrom Customer Service Department.