



ENSTROM HELICOPTER CORPORATION

2209 22ND STREET, P.O. BOX 490, MENOMINEE, MICHIGAN 49858-0490 USA

SERVICE DIRECTIVE BULLETIN

SERVICE NOTE NO. 0026


Date: July 21, 1975

Subject: Cooling Air Turning Vane - P/N 280-126001-9

Model: 280 - Serial Numbers 1002, 1003, 1004, 1005, 1006, 1007, 1008, 1009, 1010, 1011, 1012, 1014, 1015

Compliance: As Noted Below

We have had a report from field service of one instance where the cooling air turning vane attachment failed. Separation of this attachment will allow the turning vane to shift and possibly come in contact with the cooling fan. The location of the turning vane P/N 280-12~001-9 is shown in the illustration below:

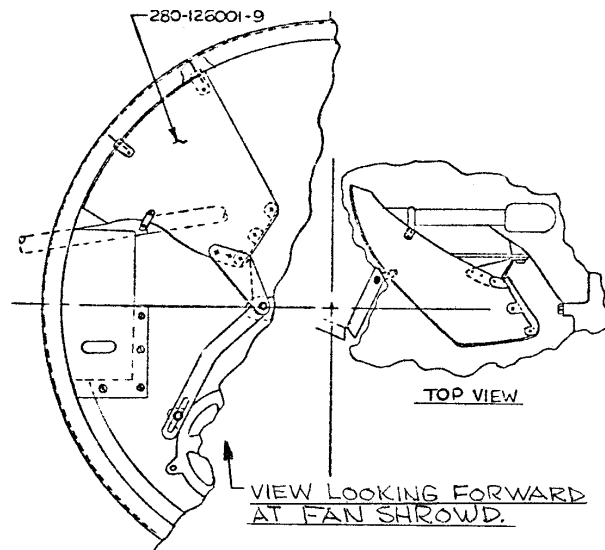

Immediate visual inspection of the turning vane P/N 280-126001-9 should be accomplished. This inspection is to be repeated at 5-hour intervals thereafter. Access for inspection can be made through upper left engine cooling shroud panel. It is further recommended that a new turning vane (P/N 280 -126001 -9, Rev. A) be installed to eliminate this inspection requirement. This component is available through Enstrom Customer Service.

UNCONTROLLED COPY WHEN DOWNLOADED OR PRINTED

Visit www.enstromhelicopter.com to register for email notification of updates.