



THE ENSTROM HELICOPTER CORPORATION
TWIN COUNTY AIRPORT, P.O. BOX 490, MENOMINEE, MICHIGAN 49858

SERVICE INFORMATION LETTER

SERVICE INFORMATION LETTER NO. 0082

Date: December 13, 1978

Subject: Replacement Oil Lines

Models: F-28C and 280C

Effectivity: All aircraft up to Serial Numbers 425 and 1145

Compliance: At Owners Discretion and Convenience

There have been three reported incidences of oil coolers cracking at the oil line attachment boss. These isolated cases may have been due to abnormal stress during maintenance in the rigid oil lines going to the oil cooler.

To eliminate reoccurrence of this problem, or reduce the possibility of a failure, the rigid steel oil lines may be replaced with flexible oil line assemblies.

Parts required:

- 1 each 28-121013-1 Hose assembly
- 1 each 28-121014-1 Hose assembly
- 2 each 848FSO10-08 Adapter
- 3 each MS21919-F12 Clamp
- 1 each MS21919-F14 Clamp
- 6 each MS21919-F16 Clamp

These parts may be purchased from the Enstrom Customer Service Department