




Enstrom Maintenance Alert

12/19/14

4129104-() Oil Cooler Bearing Support.

Enstrom 480B, 1400 hrs

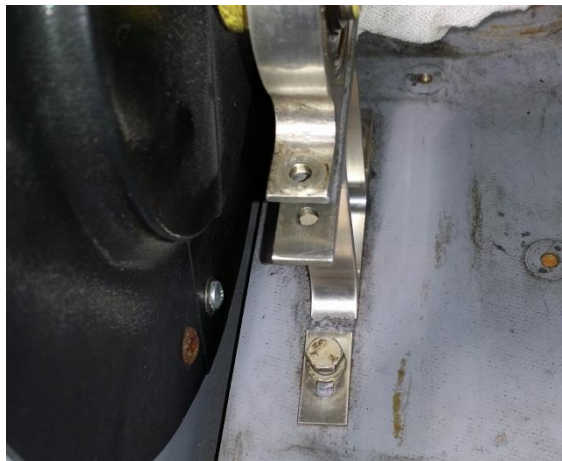

It was reported that a technician found a cracked oil cooler blower bearing support bracket. He was having trouble aligning the blower short shaft. This support bracket was replaced by a 4129104-19 bracket which has a thicker bottom flange.

Enstrom recommends occasional cleaning of the fan squirrel cage fan to prevent out of balance, and installation of the -19 support bracket.