




ENSTROM
HELICOPTER CORPORATION

2209 22nd Street
Menominee, Michigan 49858 USA
W EnstromHelicopter.com
P 906-863-1200
f 906-863-6821

Stinger Tube Bracket/Rivet Repair

Smoking around the rivets through the stinger tube attach bracket usually indicate looseness of the bracket. If they are found loose, it's much easier to replace the rivets with structural screws than over size rivets. The screws that hold gas tanks into a Piper Cherokee wing are the proper size to use in the tailcone brackets.

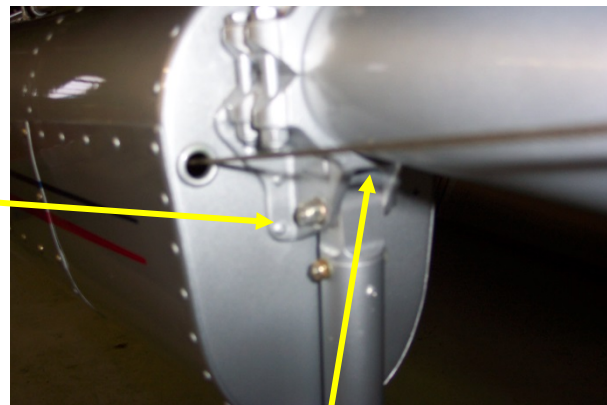

MS27039-0809 or AN525-832R8

Push up and down on the stinger tube with your finger across the casting to determine whether the stinger tube and bracket are loose on the bulkhead.